


COLORBLAST 6 FIXTURE  
(MAXIMUM OF 2 PER PDS-60)

COLORBLAST 6 FIXTURE  
(MAXIMUM OF 2 PER PDS-60)

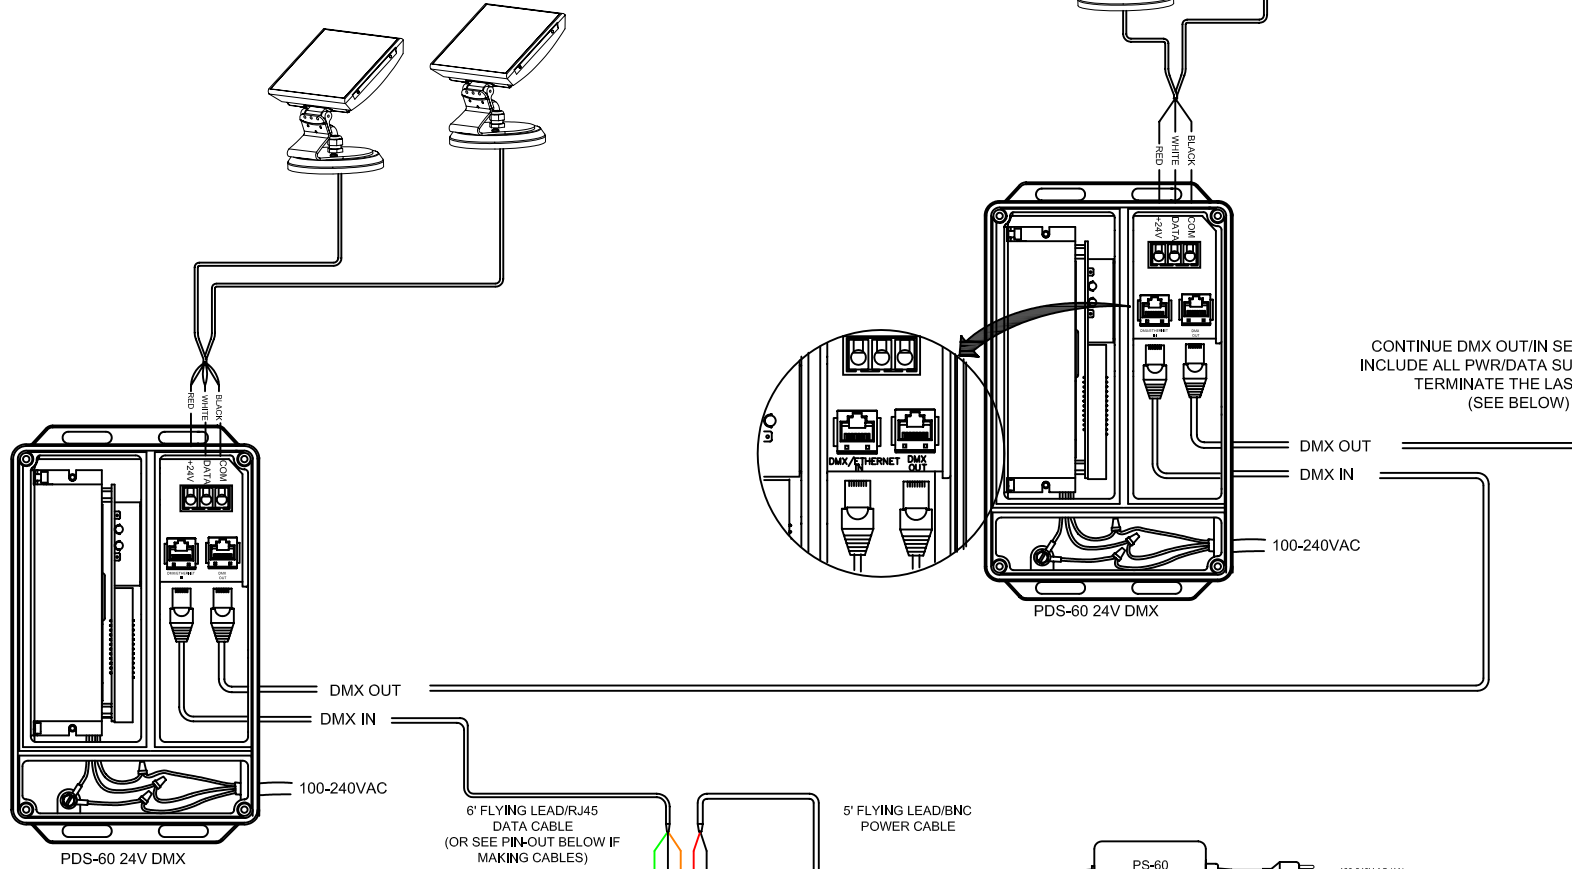

CONTINUE DMX OUT/IN SEQUENCE TO  
INCLUDE ALL PWR/DATA SUPPLIES, THEN  
TERMINATE THE LAST UNIT  
(SEE BELOW)

6' FLYING LEAD/RJ45  
DATA CABLE  
(OR SEE PIN-OUT BELOW IF  
MAKING CABLES)

5' FLYING LEAD/BNC  
POWER CABLE

COLORDIAL  
(BACK VIEW)


F-F PWR  
COUPLER

PS-60  
PWR SUPPLY

100-240V AC (1A)

**NOTE:**  
- USE A THIRD PARTY DMX REPEATER ON EVERY 32nd PDS UNIT IN A CHAIN, OR  
WHEN THE TOTAL DMX DATA RUN EXCEEDS 1,000 FEET. REFER TO THE USITT  
DMX-512 STANDARD FOR MORE INFORMATION.  
- MAXIMUM NUMBER OF FIXTURES PER PDS-60: 2

DATA TERMINATOR



PLACE IN LAST DMX OUT PORT OF  
POWER/DATA SUPPLY CHAIN

CAT-5/RJ45 PIN-OUT



(VIEW FACING PINS)



COLOR KINETICS INCORPORATED  
10 MILK STREET, SUITE 1100  
BOSTON, MA 02108  
888 FULL RGB  
617 423 9999  
[WWW.COLORKINETICS.COM](http://WWW.COLORKINETICS.COM)

"FULL SPECTRUM DIGITAL LIGHTING"

TITLE:

SYSTEM WIRING DIAGRAM (TYP)

PRODUCTS:

CB6 / PDS-60 24V / CD / PS-60

DATE:

DWG. BY: B.T.

SCALE: NTS

REV:

PAGE: 1 OF 1